

**SONY.**

## Video/RGB Monitor Service Bulletin

Sony Service Company - Technical Services  
A Division of Sony Corporation of America  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** PVM3230, PVM4300

**No. 2**

**Subject:** CCD Comb Pack Change

**Date:** March 12, 1993


**Symptom:**  
(133)

No vertical sync or picture distortion (light areas of the picture may be dragged to the right).


**Solution:**

Exchange the CCD Comb Pack "CCP-2" with the new one "CCP-2A".

MODEL	PART DESCRIPTION	BOARD	"NEW" PART NUMBER
PVM3230	CFB301: "CCP-2A"	B	1-808-703-12
PVM4300	CFB301: "CCP-2A"	B2	1-808-703-12

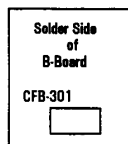

PVM3230

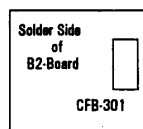

PVM4300

CSI-112 PVM Monitors